

Work Order ID 92475

92475

Page 1

October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Aft

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: ML5

Date: 12-10-30

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D412-664-243

E/DEO

SP

100

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D412-664-203 CHG 009

110

0.00

110

Packaging

Packaging

Memo

0.00

Packaging

120

0.00

120

BENDING MACHINE - CROSSTUBES

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D412-664-243 using CNC bender program 412-08-10
Folio 12-10-10

D412-664-203/92475

DAS 15 12-11-201

1 JG/ML5 12-11-28

PTO →

MO 12/10/31

MO/RM 12-11-1

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: h Date: 12/12/12QA Closed: h Date:

Work Order: <u>92475</u> Part No. <u>D412-664-203</u> NCR No. <u>12-2099</u>				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input checked="" type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
--	--	--	--	--	--	--	--	--	--	--	--

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>	12/11/1	100	1	CRUSHING IS OVER TOL	12/12/12	Acceptable per attached S.R.	12/12/12	DAS 16 0-03	DAS 16 0-03
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input checked="" type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY			
Landing Gear <input checked="" type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Work Order ID 92475

92475

Page 2

October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Aft

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

130

QC15- Crosstube Dimensional Check

0.00

130

QC

Memo

0.00

DAS 16 12/11/01

Quality Control

140

0.00

140

Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551 and drill table DT8577 using #9 holes as per QSI 10 to install towers.

2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-SCRIBE PART # & BATCH #

4- *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243

MO

12/11/01

MO

12/11/05

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	

Work Order ID 92475

92475

Page 3

-October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Aft

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:


Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160 *160* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***	0.00 0.00	DAS 03 9-89			12-11-7			
170 *170* HandFXtube Hand Finishing Crosstubes	Memo *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** 1- CLEAN CROSSTUBE WITH WASH'N WIPE	0.00 0.00				1	0	0	AP 12-11-8
180 *180* Outsource2 Outsource process - NDT	Outsource process - NDT per QSI038 4.1 Memo *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038Or Issue P/O: 18365 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order	0.00 0.00				CX	12/11/08	①	

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Work Order ID 92475

92475

Page 4

October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Aft

Stop ***NS2***

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	Packaging	0.00							
190									
Packaging	Memo	0.00							
Packaging	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Inspect for transit damage Ensure copy of NDT results attached to work order.								
200	QC5- Inspect part completeness to step on W/O	0.00							
200									
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Inspect for damage & ensure results are as per Dwg D412-664-203								
203		0.00							
203									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN CROSSTUBE BEFORE CHEMICAL CONVERSION								

10/12/12 @

DAS
05 12 11 25
9-89

1 0 0 12
12-11-8

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
FAULT CATEGORY											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		

Work Order ID 92475

92475

October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Aft

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

205 QC7-Inspect Chemical Conversion Coat

0.00

205

QC

Memo

0.00

Quality Control

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

DAS
05
9-89 12 11 25

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
FAULT CATEGORY											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		

Work Order ID 92475

92475

Page 6

October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Aft

Stop ***NS2***

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start ***NR1***

QC: Date: SPC (Y/N): Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	SprayPaint	0.00							
210									
SprayPaint	Memo	0.00							
Spray Painting	<p>*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***</p> <p>***Mask underside of crosstube as shown***</p> <p>1-Prime inside and outside crosstube as per QSI 005 4.2</p> <p>2-Paint outside crosstube with White Imron as per DEO D412-664-243 and QSI 005 4.2</p> <p>clear: 121625</p> <p>PRIME: 122888</p> <p>Start Time: 6:30</p> <p>Finish Time: 7:20</p> <p>PAINT: 123591</p> <p>Start Time: 1:30</p> <p>Finish Time: 2:30</p> <p>3- Apply clear coat after paint as per DEO</p>								

12-11-22

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY												
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	

Work Order ID 92475

92475

Page 7

October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Aft

Stop ***NS2***

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

220 QC14- Inspect Spray Paint

0.00

220

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

15/16/12 12/11/23

230

0.00

230

Crosstubes

Crosstubes

Memo

0.00

Crosstubes

Assemble as per Dwg D412-664-203

1- Install chafing shield as per DEO D412-664-243. Top holes should be facing up.

A/R Proseal 890 Batch: 123103
EXP: 03/13

2- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

3- Install support with Scotch-Weld DP460 and install clamps as per DEO Dwg D12-664-243 using installation jig DT9024. Torque clamps as per dwg

A/R Scotch-Weld DP460 Batch: 122900
EXP: 1.9.13

DAS
05/12/11/25
2-89

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY									
Landing Gear			General						
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Pressure/Forced					
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware	<input type="checkbox"/> Over/Under tolerance	<input type="checkbox"/> Temperature/Cure					
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Part Incorrect	<input type="checkbox"/> Weld					
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Lost/Missing	<input type="checkbox"/> Wrong Stock Pulled					
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Part Moved						
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Positioned Wrong						
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread	<input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Other					
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset							
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration							
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence							
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions							

Work Order ID 92475

92475

Page 8

*October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Crosstube Aft

Stop *NS2*

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

240

QC5- Inspect part completeness to step on W/O

0.00

240

QC

Memo

0.00



12/11/29

Quality Control

250

Pick Kit

0.00

250

Packaging

Memo

0.00

1X

6/11/28
DAS 20 2-89

SP
12-11-27

Packaging

260

QC4- 100% Inspect kits for completeness

0.00

260

QC

Memo

0.00



12/11/29

Quality Control

1

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
FAULT CATEGORY											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		

Work Order ID 92475

92475

Page 9

October-30-12 3:15:32 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Aft

Start Date: 30/10/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/11/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start *NR1*

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270		0.00							
270	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D412-664-203 *****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27 for application time & date ***** Time & date of packaging: <u>PK 103</u> Location: <u>PK 103</u>								
280	QC21- Final Inspection - Work Order Release	0.00							
280									
QC	Memo	0.00							
Quality Control									

DAS
20
89

12/12/3 JF

MF

12-11-30

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY												
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	

Picklist Print

October-30-12 3:15:38 PM

Page 1

Work Order ID: 92475

92475

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Crosstube Aft

Start Date: 30/10/2012

Required Date: 13/11/2012

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:E04.02.16Reformat; Added D3189-1K/DS
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
 IPP Rev:G 06.12.08 per ECN 886 EC
 IPP Rev:H 07-04-30 As per Rev D JLM
 IPP Rev:I 08-06-12 add comment in seq. 21 DD verified by:EC IPP rev J
 11.04.21 DEO D412-664-243-E-1 EC verified DD IPP REV:K
 11.10.03 DEO D412-664-243-E-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D412-664-203TRN		Manufactured	No			110	Each	4.0000	1	1			

D412-664-203TRN

Crosstube Turning Detail

Location	Loc Qty	Loc Code
LG	4	
83835	1	
87158	1	
90960	1	
90961	1	

① MO 12/10/31

D2896-1 Manufactured No

230 Each 33.0000 1 1

D2896-1

Support

**

12/11/25

Location	Loc Qty	Loc Code
LG053	33	
74465	8	
86663	12	
88695	13	

D3189-1 Manufactured No

230 Each 16.0000 2 2

D3189-1

Chafing Shield(send DSI9629 with spares)

**

12/11/25

Location	Loc Qty	Loc Code
LG053	16	
89901	16	

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; font-size: small;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Picklist Print

October-30-12 3:15:38 PM

Page 2

Work Order ID: 92475

92475

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Crosstube Aft

Start Date: 30/10/2012

Required Date: 13/11/2012

Start Qty: 1.00

Required Qty: 1.00

D3595-063-570

Manufactured No

230

Each

105.0000

2

2

D3595-063-570

RUBBER CUSHION

**

12/11/25

Location

Loc Qty

Loc Code

FG

8

37971

1

42243

7

LG

78

~~83294~~

78

MAT052

19

71534

1

76546

18

MS21920-28

Purchased

No

230

Each

95.0000

4

4

MS21920-28

Clamp(per MIL-DTL-8783C)

**

12/11/25

Location

Loc Qty

Loc Code

FG

5

105884

5

LG050

10

118713

3

120054

2

122518

5

LG051

80

121440

8

122204

10

122838

14

123243

48

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY									
Landing Gear			General						
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Pressure/Forced					
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware	<input type="checkbox"/> Over/Under tolerance	<input type="checkbox"/> Temperature/Cure					
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Part Incorrect	<input type="checkbox"/> Weld					
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Lost/Missing	<input type="checkbox"/> Wrong Stock Pulled					
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Part Moved						
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Positioned Wrong						
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread	<input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Other					
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset							
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration							
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence							
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions							

Picklist Print

October-30-12 3:15:38 PM

Page 3

Work Order ID: 92475

Parent Item: D412-664-203

Parent Item Name: Crosstube Aft

92475

D412-664-203

Start Date: 30/10/2012

Required Date: 13/11/2012

Start Qty: 1.00

Required Qty: 1.00

MS21920-30

Purchased

No

230

Each

101.0000

2

2

MS21920-30

clamp(per MIL-DTL-8783C)

**

12-11-25

Location

Loc Qty

Loc Code

LG

7

119529

7

LG050

50

123240

50

LG051

44

111258

14

121583

30

AN6-40A

Purchased

No

250

Each

80.0000

4

4

AN6-40A

Bolt

**

SP

SP

Sm's

Location

Loc Qty

Loc Code

ST340

74

122416

24

123021

50

ST342

6

120833

4

121827

2

4x

AN6-41A

Purchased

No

250

Each

35.0000

2

2

AN6-41A

Bolt

**

SP 12-11-27

SP

Sm's

Location

Loc Qty

Loc Code

ST340

34

122407

34

ST342

1

121825

1

2x

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
FAULT CATEGORY											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		

Picklist Print

October-30-12 3:15:38 PM

Page 4

Work Order ID: 92475

Parent Item: D412-664-203

Parent Item Name: Crosstube Aft

92475

D412-664-203

Start Date: 30/10/2012

Required Date: 13/11/2012

Start Qty: 1.00

Required Qty: 1.00

AN960ID616

NAS149D06631

Purchased

No

250

Each

0.0000

18

18

AN960.ID616

Washer

MS21042I6

Purchased

No

250

Each

934.0000

6

6

MS21042I 6

Nut

SM

Location

Loc Qty

Loc Code

314

195

122441

195

ST300

239

117677

25

118384

3

118927

48

119075

4

120308

159

ST314

500

123248

350

123355

150

**

**

M123265 SP

SPB-11-27

60

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____


QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY									
Landing Gear			General						
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Pressure/Forced					
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware	<input type="checkbox"/> Over/Under tolerance	<input type="checkbox"/> Temperature/Cure					
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Part Incorrect	<input type="checkbox"/> Weld					
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Lost/Missing	<input type="checkbox"/> Wrong Stock Pulled					
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Part Moved	<input type="checkbox"/> Other					
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Positioned Wrong						
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread	<input type="checkbox"/> Power Loss/Surge						
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset							
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration							
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence							
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions							

DART AEROSPACE LTD		Work Order:	92475
Description: Crosstube High Aft (412)		Part Number:	D412-664-203
Inspection Dwg: D412-664-243 Rev: E		Page 1 of 1	

Required Dimension	Min	Max
Height	24.24	24.50
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70
Bending Passes	8	--
Crushing	--	6%

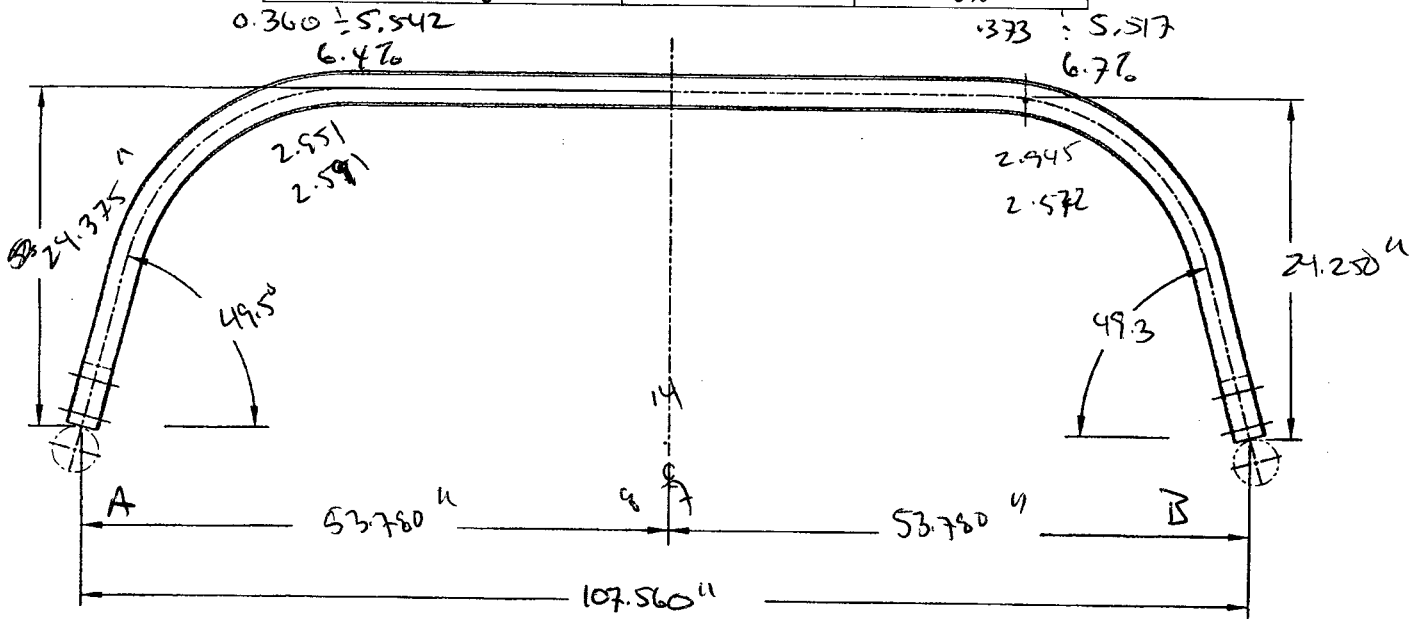

	Side A	middle	Side B
Bending Passes	8	14	7
Crushing	6.4%		6.7%
Comments			
Side A = 6.4% crushing @ 8 Passes.			
middle = 14 Passes.			
Side B = 6.7% crushing @ 7 Passes.			

QC15 Inspection	(DAS
Date	16 12/14/01

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. D	KJ/JLM	
C	10.02.02	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	IP

Item	Qty	Part Number	Description
	-243		
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 47.0 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER


NO 92475ML5

12-10-30


2 DEO ATTACHED

RELEASED
2009-10-29


E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087. ADD D2732-058 & MAGNOBOND 6398. MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. REV. E D412-664-243 SHEET 1 OF 4 TITLE SCALE CROSSTUBE ASSEMBLY (412 HI AFT) NTS COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DRAWN	RF		
CHECKED	PH		
MFG. APPR.	PH		
APPROVED	PH		
DE APPR.	PH		
DATE	09.09.30		

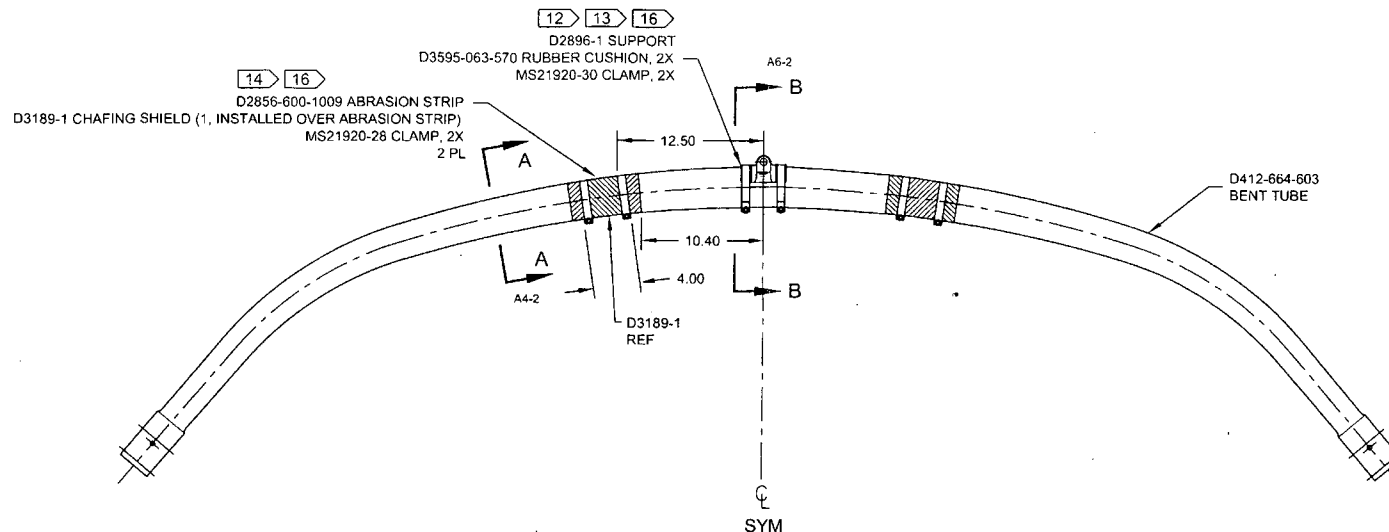

D212-664-243
ASSEMBLY DETAIL

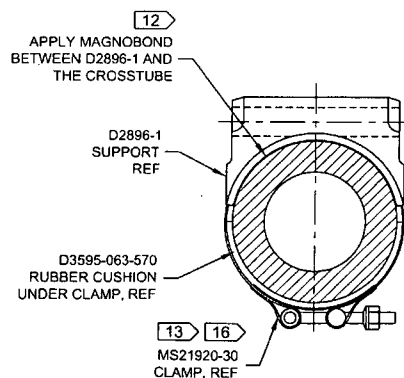

SECTION B-B D4-2
SCALE 4X

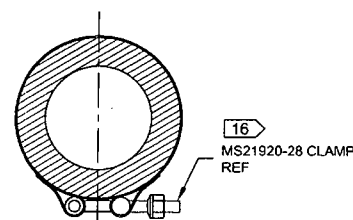


SECTION A-A C6-2
SCALE 4X

RELEASED
2009-10-28

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. E
MFG. APPR.	SS	D412-664-243	SHEET 2 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	11	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


92475

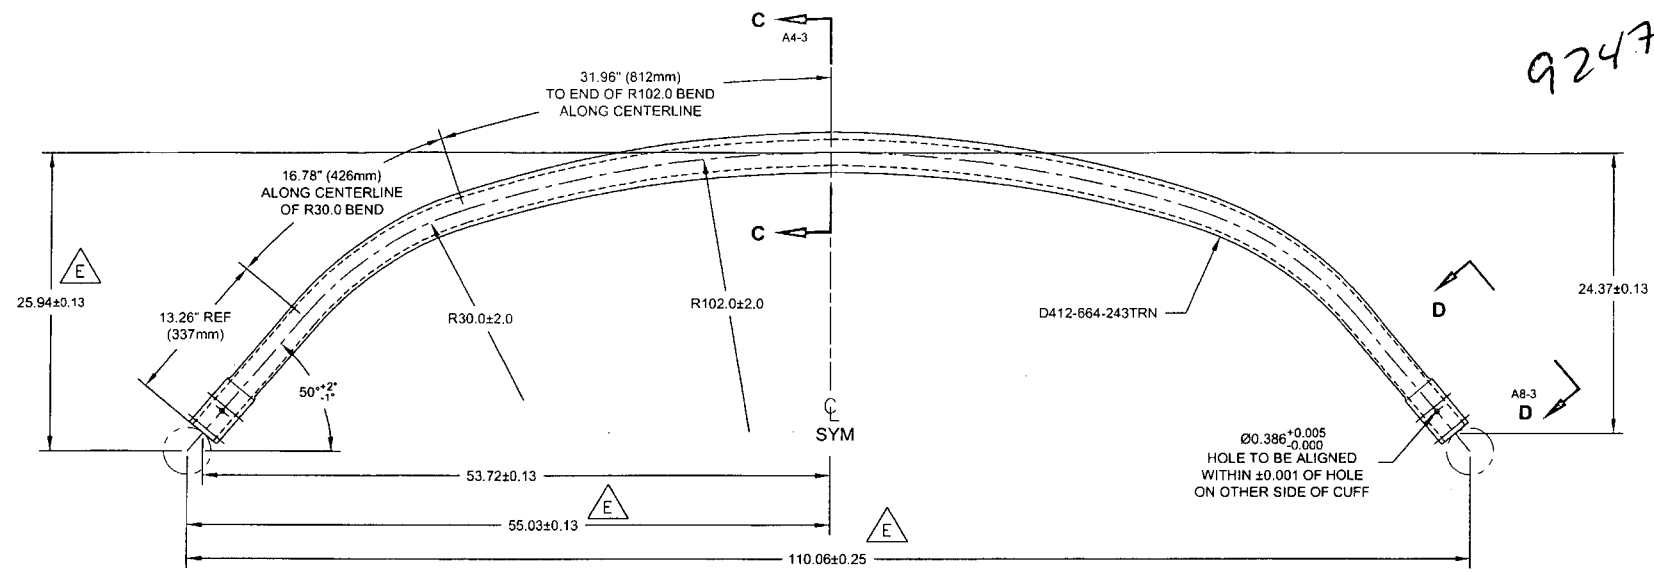


D412-664-603 10
BENDING AND DRILLING DETAIL E

② DEO ATTACHED

RELEASED
 2009-10-29
 MP

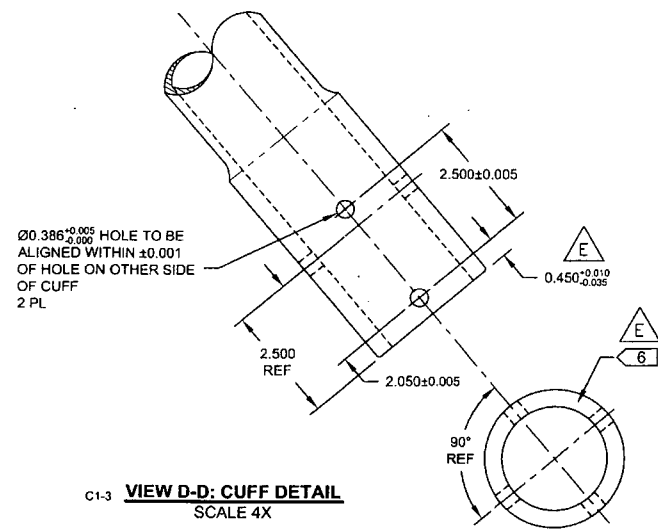



C1-3 **VIEW D-D: CUFF DETAIL**
 SCALE 4X

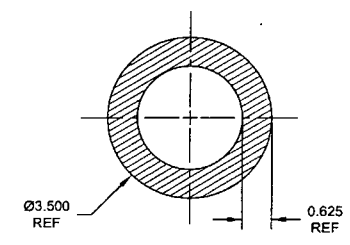

SECTION C-C D5-3
 SCALE 4X


DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. E
MFG. APPR.	10	D412-664-243	SHEET 3 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	10	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCE WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

92475

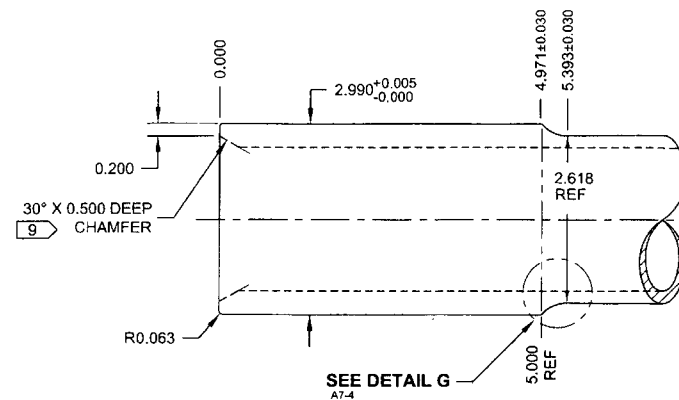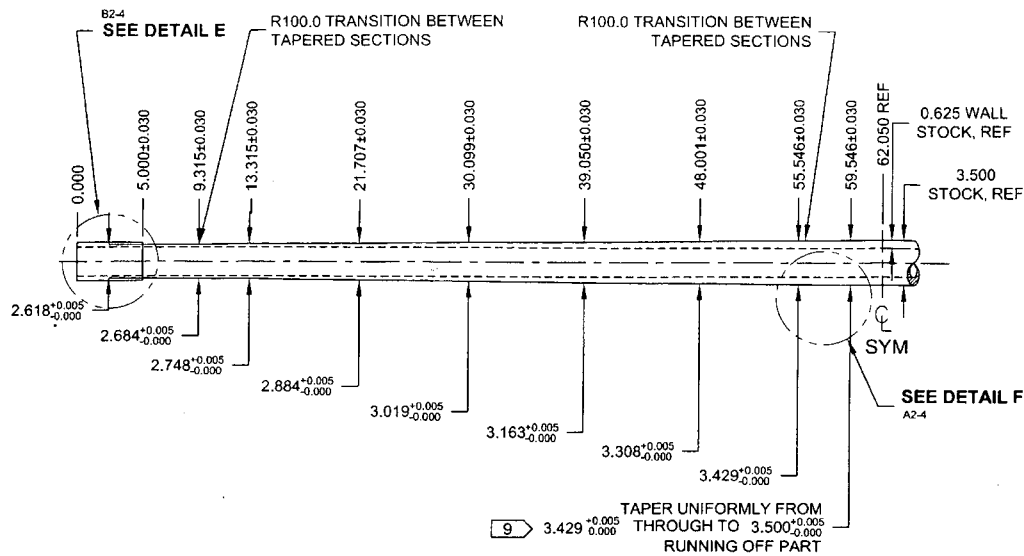


DETAIL E:
CROSSTUBE CUFF D8-4
SCALE 5X

D412-664-243TRN
TURNING DETAIL

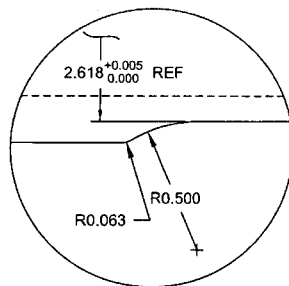

DETAIL G:
CUFF TRANSITION C2-4
SCALE 10X

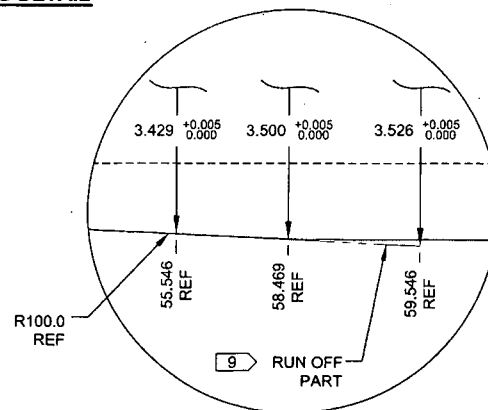

DETAIL F:
TAPER RUN-OFF C4-4
NOT TO SCALE

2 DEO ATTACHED

RELEASED
2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. E
MFG. APPR.	10	D412-664-243	SHEET 4 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	10	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.03.31	DATE 11/03/31	DATE 11.03.31	DATE 11/03/31	DATE 11-03-31			

92475

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

WAS:

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2 AND 14, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1
CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEAL D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF
PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

RELEASED
2011-04-07
MDL

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN <i>MD</i>	CHECKED <i>MD</i>	MFG. APPR. <i>EE</i>	APPROVED <i>MD</i>	DE APPR. <i>MD</i>		
DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31		

92475

IS:

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)
MS21920-28 CLAMP, 2X
2 PL

WAS:

D2856-600-1009 ABRASION STRIP
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)
MS21920-28 CLAMP, 2X
2 PL

D412-664-603
BENT TUBE

D3189-1
REF

**D412-664-243
ASSEMBLY DETAIL**

RELEASED
2011-04-07
MD

MASK AREA PRIOR TO PAINTING AND
APPLY CLEAR COAT AFTER PAINTING

Q
SYM

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASS'Y (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>92</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>RE</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

92475

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -243	Part Number	Description
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 16, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MP

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 1 OF 3	SCALE NTS
DRAWN 90	CHECKED A	MFG. APPR. A	APPROVED MP		DE APPR. MP		
DATE 12.08.21	DATE 12.08.30	DATE 12.08.30	DATE 12/8/30		DATE 12.08-30		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890. UPDATE INSTALLATION OF CHAFING SHIELDS AND REDUCE TORQUE TO 40-50 IN-LBS. THIS ENGINEERING ORDER SUPERCEDES DEO D412-664-243-E-1.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

WAS:

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2, 14, AND 16 ON SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 16) TORQUE CLAMPS ON D2896-1 SUPPORT 80 TO 100 IN-LB. **TORQUE CLAMPS ON D3189-1 CHAFING SHIELD 40 TO 50 IN-LB.** ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2012-09-04
MP

92475


DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 2 OF 3	SCALE NTS
DRAWN <i>gp</i>	CHECKED <i>[Signature]</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DE APPR. <i>[Signature]</i>		
DATE 12.08.21	DATE 12.08.21	DATE 12.08.21	DATE 12.08.21	DATE 12.08.21		

IS:


D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)
MS21920-28 CLAMP, 2X
2 PL

WAS:

D2856-600-1009 ABRASION STRIP
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)
MS21920-28 CLAMP, 2X
2 PL

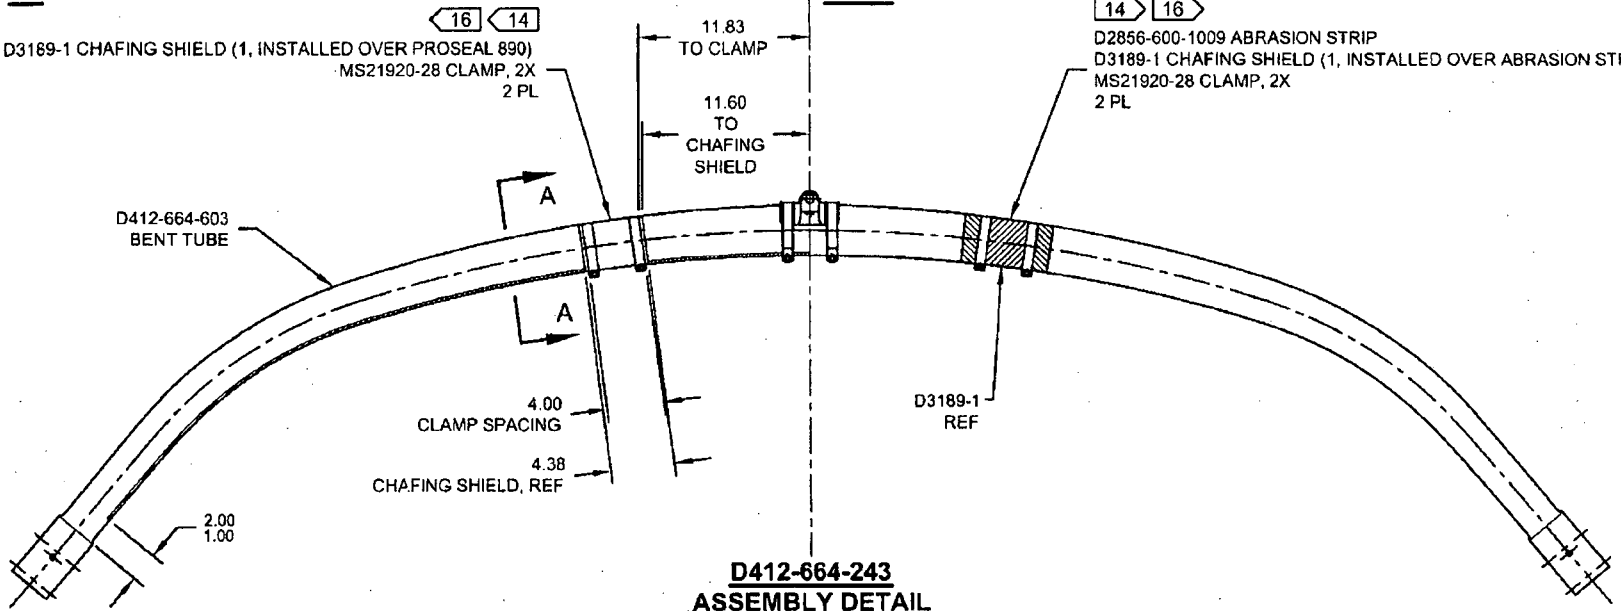


**D412-664-243
ASSEMBLY DETAIL**

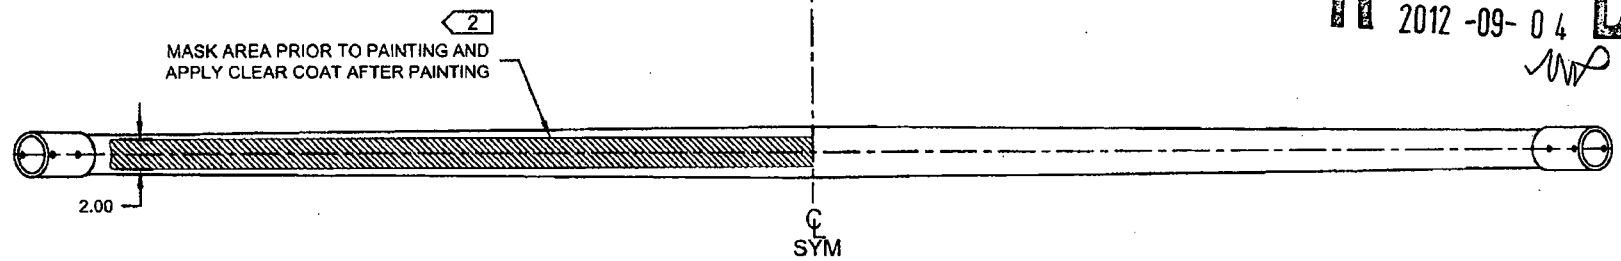

RELEASED
2012-09-04
[Signature]

92475

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 3 OF 3	SCALE NTS
DRAWN <i>MP</i>	CHECKED <i>MP</i>	MFG. APPR. <i>MP</i>	APPROVED <i>MP</i>	DE APPR. <i>MP</i>		
DATE 12.08.21	DATE 12.08.22	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29	

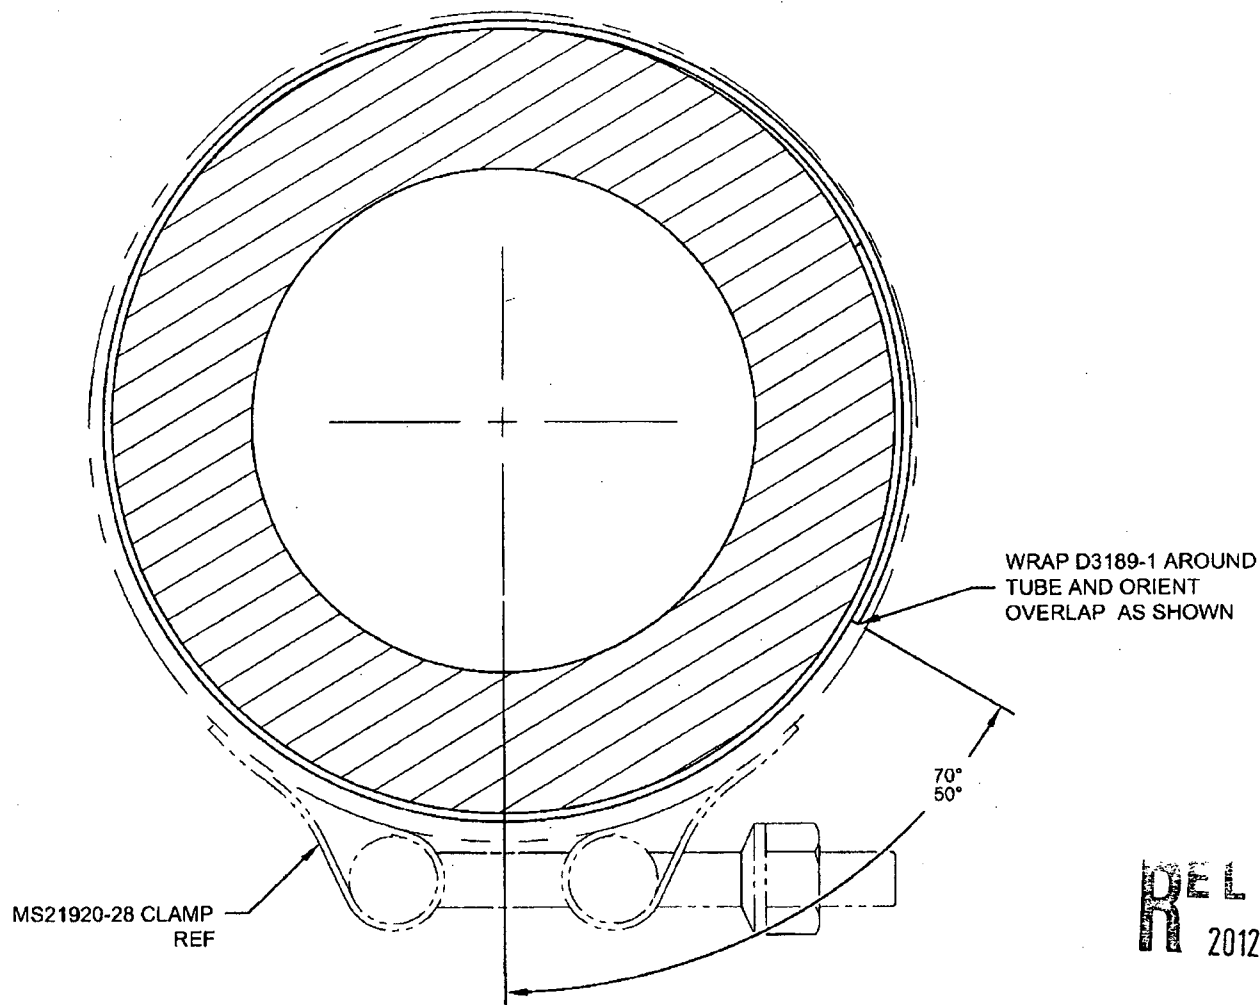

SECTION A-A
CHAFING SHIELD DETAIL
VIEW ROTATED, NOT TO SCALE


RELEASED
2012-09-04
MP

COPYRIGHT © 2012 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

CRUSHING OF D412-664-243

11.12.06

Acceptability of 8% CRUSHING AT END OF BEND

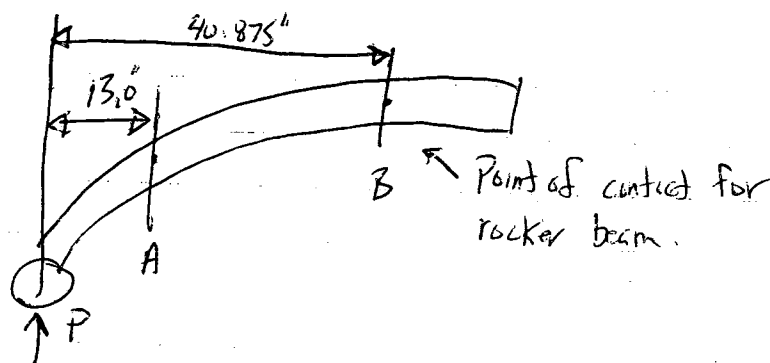

Point A: $OD_1 = 2.961"$, $OD_2 = 2.522"$

$CRUSHING = (2.961 - 2.522) / (2.961 + 2.522) = 8\%$

$I = 1.676 \text{ in}^4$ (from AutoCAD)

Point B: $OD_1 = 3.307"$, $I = 4.613 \text{ in}^4$

A: $F = M_c / I = P \times 13 \times 2.961 / 2 \times 1.676 = 11.484 \cdot P$

B: $" = P \times 40.875 \times 3.307 / 2 \times 4.613 = 14.651 \cdot P$

M.S. = $14.651 / 11.484 - 1 = 0.27$

∴ Tube will break at rocker beam contact before area of 8% crushing; 8% crushing in area at end of tube bend is acceptable

11.12.06



LIQUID PENETRANT TEST REPORT

P- 12683

CLIENT

ATTENTION

ADDRESS

PROJECT

ITEM(S) EXAMINED

DATE

ACUREN JOB NO.

POWOW NO.

WORK LOCATION

ACCEPTANCE STD

PAGE 1 OF 1
TIME AM ☒ PM ☐

DART AEROSPACE
ADDY.
1270 ABERDEEN
HAWKES BURY, ONT.

Nov 8/12
198-12-CO 395

18365

Same

REV./DATE 2005

F.P.I. on CROSS TUBES

(7)

JOB DESCRIPTION

PROCEDURE NO. LT 002 REV./DATE 2008

TECHNIQUE NO. LT 1012 REV./DATE 2008

PART NO. SEE RESULTS

MATERIAL ALUMINUM

THICKNESS VARIOUS

SCOPE

TEST DETAILS

METHOD	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH	<input type="checkbox"/> SOLVENT REMOVABLE	<input type="checkbox"/> POST EMULSIFIED
FAMILY BRAND	MAGNAFLUX		BLACK LIGHT S/N	16459	<input type="checkbox"/> OUTPUT > 1000 μ W/cm ²
PENETRANT	2607	MINIMUM DWELL TIME	45	MIN.	<input type="checkbox"/> FLASHLIGHT <input type="checkbox"/> TROUBLELIGHT
PENETRANT REMOVER	420	MINIMUM DRY TIME	>10	MIN.	<input type="checkbox"/> OUTPUT > 100 fc @ SURFACE
DEVELOPER	SKD 52	MINIMUM DWELL TIME	10	MIN.	OTHER LABINO
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS	<input type="checkbox"/> AQUEOUS	<input type="checkbox"/> DRY	LIGHT METER S/N	1098866
					CAL DUE DATE Nov 12 2012

TEST SURFACE

SURFACE CONDITION	<input type="checkbox"/> AS GROUND	<input type="checkbox"/> AS WELDED	<input checked="" type="checkbox"/> MACHINED	<input type="checkbox"/> SHOT BLASTED	<input checked="" type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < - 4°C/ 20°F	<input type="checkbox"/> - 4°C/ 20°F TO 10°C/50°F	<input checked="" type="checkbox"/> 10°C/50°F TO 52°C/125°F	<input type="checkbox"/> > 52°C/125°F	

RESULTS-

(☐ METRIC ☐ IMPERIAL)

ITEM	COMMENTS	ACCEPT	REJECT
1	CROSS TUBES - W.O. #		
1	" " 90205	✓	
1	" " 89392	✓	
1	" " 77285	✓	
1	" " 86936	✓	
1	" " 92476	✓	
1	" " 92475	✓	
1	" " 602040	✓	

Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE	Andy Sheldon	PRINT	SIGNATURE	DTR # E-120255	
TECHNICIAN (SIGNATURE):	A. Keith	1 ST TECHNICIAN	2 ND TECHNICIAN	REPORT REVIEWED BY:	
NAME (PRINT):	A. Keith	CGSB LEVEL	SNT LEVEL	NAME	INITIALS
		CGSB REG. NO. 6606	CGSB REG. NO.		

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY